



THE

Indian

MOTORCYCLE COMPANY • 1535 West Rosecrans Avenue, Gardena, Calif. 90249

SVB-115
6/20/72

Page 3 of 3

Trouble shooting continued

The main jet effects the carburetor at full throttle position. If the Motorcycle "4 strokes" or misses very bad at wide open throttle the main jet is too large (rich). If the Motorcycle surges or hesitates or pops or spits back at full throttle the main jet is probably too small (lean).

