

SERVICE BULLETIN



THE *Indian* MOTORCYCLE COMPANY

Bulletin No. SVB-147

Model MM-5A

Subject Kickstarter

Date 10-3-73

KICKSTART RATCHET ENGAGING

On the kick forward model engine (S5K2) the ratchet will sometimes fail to engage. This is because the snap ring that positions the kickstart shaft comes out of the groove. To fix this problem install as necessary, shims (part #25-4007) behind the snap ring. There should only be .002 to .004 clearance between the clutch cover case and the snap ring.



