

SERVICE BULLETIN



THE
Indian MOTORCYCLE COMPANY

Bulletin No. SVB-149

Model ME-100A

Subject OIL PUMP LEAKS

Date December 4, 1973

ME-100A OIL PUMP LEAKS

On some ME-100A motorcycles with oil injection the banjo bolts on the oil pump and intake manifold will not tighten up properly. This is because the threads on the bolt will bottom out before it tightens up the soft aluminum washer. If this problem exists on any of your customer's motorcycles, just add one or more soft aluminum washers. Do not over tighten the banjo bolts (3 to 4 foot lbs.).

