



THE

Indian

MOTORCYCLE COMPANY

2535 S. Fairfax, Culver City, CA 90230

Date March 3, 1975 **Page** 1 of 1

FACTORY SERVICE BULLETIN

Number	SVB-178
Model	ME, MT-125 MX-74/76
Subject	HIGH TENSION COIL

HIGH TENSION COIL

On some motorcycles the high tension coil mounting bracket has been misplaced during assembly. The coil will actually touch the inside of the gas tank causing misfiring and "fouled" spark plugs.

To check for this bad condition, simply reach up under the gas tank on the right hand side, and "feel" with your hand. If the coil is touching the gas tank, you must remove the gas tank and "bend" the coil mount bracket in approximately 1/16" to 1/8" inch. This will prevent the coil from hitting the tank, and eliminate many misfiring or poor running problems.

This procedure can be done while preparing the motorcycle for sale, as you should remove the gas tank and "flush" out any oil or debris before putting gas in for the first time.

